


HERITAGE-WTI, Inc.

1250 St. George Street
East Liverpool, Ohio 43920-3400
Phone: 330-385-7337
Fax: 330-385-7813
Web Site: www.heritage-wti.com

OHSAS 18001: 2007

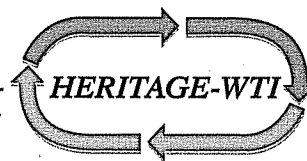

ISO 9001: 2008

ISO 14001: 2004

August 25, 2010
VIA UPS

Mr. George Czerniak, Chief
U.S. EPA Region V
Air Enforcement and Compliance Assurance
Branch
Mail Code AE-17J
77 West Jackson
Chicago, IL 60604

Ms. Pamela Korenewych
OEPA-DAPC-NEDO
Environmental Specialist
2110 E. Aurora Road
Twinsburg, OH 44087

RE: HERITAGE-WTI, INC.
EXCESSIVE EXCEEDANCE REPORTING

Dear Mr. Czerniak:

Please find enclosed a written report entitled MACT Excessive Exceedance Report for Heritage-WTI, Inc. This report is required by 40 CFR 63.1206 (c)(3)(vi) whenever there is more than ten emission standard or operating parameter exceedances that occur within a sixty-day period.

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are certain penalties for submitting false information including the possibility of fine and imprisonment for knowing violations.

Thank you and if you have any questions or comments, please call me at the above number.

Sincerely,

Frank Murray
General Manager
Heritage-WTI, Inc.

cc: Ed Fasco, Ohio EPA-DAPC-NEDO



Recycled Paper

MACT EXCESSIVE EXCEEDANCE REPORT

Heritage-WTI, Inc

August 25, 2010

Events

#	Name	Start Time	End Time	Cause (report)	Cause Description	Corrective Actions	(hr)	(min)	(sec)
1	SCC Pressure Using Seals	7/14/2010 12:39:58 AM	7/14/2010 12:40:00 AM	Operator Error - Feed Prep	Improperly packaged material caused pressure spike.	Maintained draft using ID Fan damper.	0	0	2
2	THC	7/17/2010 8:41:22 AM	7/17/2010 9:39:22 AM	Operator Error - Feed Prep	Improperly packaged material caused pressure spike.	Restarted unit. Reduced charge size.	0	58	0
3	THC	7/22/2010 8:10:26 PM	7/22/2010 9:13:26 PM	Operator Error- Poor Operation	Lack of combustion air caused poor combustion and THC.	Increase primary air flow. Restarted unit.	1	3	0
4	THC	8/1/2010 11:54:24 AM	8/1/2010 12:22:25 PM	Operator Error - Feed Prep	Improperly packaged material caused pressure spike.	Restarted unit. Reduced charge size.	0	28	1
5	THC	8/2/2010 7:41:24 PM	8/2/2010 8:39:24 PM	Operator Error - Feed Mix	Waste stream fed with incompatible materials causing poor combustion.	Restarted unit. Revised feed instructions.	0	58	0
6	Kiln Temperature	8/4/2010 6:14:28 PM	8/4/2010 6:23:27 PM	Operator Error- Poor Operation	Operator failed to take corrective action to prevent exceedance.	Temperature re-established. Unit restarted.	0	8	59
7	THC	8/10/2010 6:55:24 PM	8/10/2010 7:53:25 PM	Operator Error - Feed Prep	Improperly packaged material caused pressure spike.	Restarted unit. Reduced charge size.	0	58	1
8	THC	8/13/2010 3:51:27 PM	8/13/2010 3:58:23 PM	Operator Error - Feed Prep	Improperly packaged material caused pressure spike.	Restarted unit. Reduced charge size.	0	6	56
9	THC	8/16/2010 7:57:27 PM	8/16/2010 8:58:26 PM	Operator Error - Feed Prep	Improperly packaged material caused pressure spike.	Restarted unit. Reduced charge size.	1	0	59
10	SCC Pressure Using Seals	8/20/2010 4:24:38 AM	8/20/2010 4:24:44 AM	Operator Error - Feed Prep	Improperly prepared material caused pressure spike.	Restarted unit. Reviewed instructions.	0	0	6

** End of report **

bcc: Env. Dept
Frank Murray
Bob Buchheit
Kevin Lloyd

file name: environ/MACT/HWC MACT/exceedances/eer10_0824